

# Manhole Inspection Summary

Manhole # S04O\_\_011MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **040** Node: **011** Status: **Found**

Insp Date: **5/2/08 10:02 AM**

Incomplete Comments

Crew: **BC JD**  
Inspector: **Chung**  
Firm: **URS**

**Location** Address: **5136 STAFFORD RD**

Cross Street: **ATHOLWOOD LA**

**Manhole** Type: **Inline** Location: **Sidewalk** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **1.5** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


**Steps** Count: **7** Missing: **0** ☐ Corroded

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **4** (ft.) ☐ Active Surcharge Present

Location View



Top View

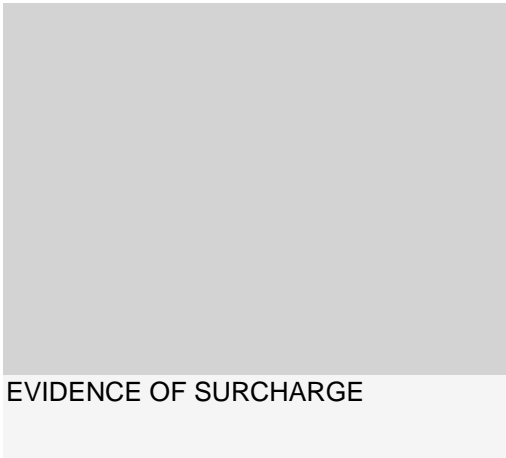

EVIDENCE OF SURCHARGE

OFFSET



GRADE ADJUSTMENT



## Manhole Inspection Summary

Manhole # S04O\_\_011MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



SLUDGE, DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **12.00** (ft.) Flow Characteristics: **Slow**  
Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease  
Silt Depth: **4** (in.) Deposits Extent: **Medium**  
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **6.70** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **10.50** (ft.)  
Inv Depth: **11.50** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S04O\_\_011MH

Printed On: 6/24/2010

Page 4 of 4

6 in. Circular Gravity Sewer  
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: **6** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.20** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**  
☐ Possible Illicit Connection